


Publication Number IS 470 Republished March 2005

Information Sheet

Pyro Mi Wiring Cables and Moisture - The Facts!

The totally inorganic insulant used in the manufacture of Pyro Mi Cables has a self blocking characteristic, and therefore they can be left unsealed during installation and storage without being adversely affected by moisture. During a period of several weeks exposure, atmospheric moisture will only penetrate to a depth of approximately 100mm, see Diagram 1, therefore the affected insulant will be removed during cable termination.

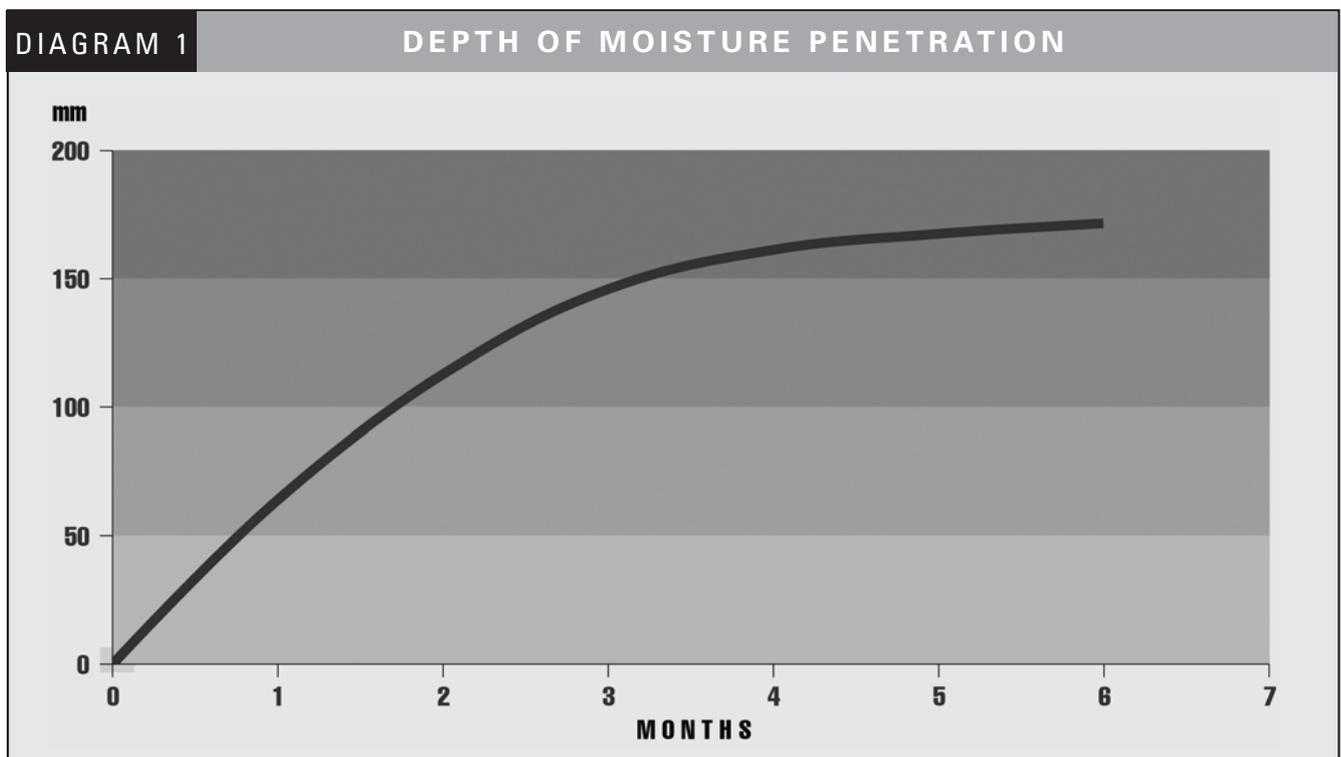

As a consequence of the above it is unnecessary to take special precautions during storage or installation of Pyro Mi Wiring Cables and the following points should be noted.

- 1** Pyro Mi Cables are manufactured to BS EN 60702-1 and have LPCB approval. Testing of un-sealed cables will result in erroneous and misleading readings therefore only cables sealed at both ends should be tested.


- 2** Temporary seals are not required during storage.

- 3** Installed cable lengths do not require temporary seals prior to fitting the terminations.

- 4** Extra length should not be left on installed cables to allow for cutting back, as this is an unnecessary and wasteful practice.

CHANGES IN INSULATION RESISTANCE BEFORE AND AFTER TERMINATING

Because of its affinity for moisture, the insulant will begin to absorb moisture as soon as it is exposed to the atmosphere, and therefore its insulation resistance will start to fall. However, the rate of this fall can vary due to the level of atmospheric humidity and slight variations in the chemical properties of the cable insulant. Therefore, it is feasible to observe differences in behaviour from day to day or cable to cable. Diagram 2 shows some typical cable behaviours.

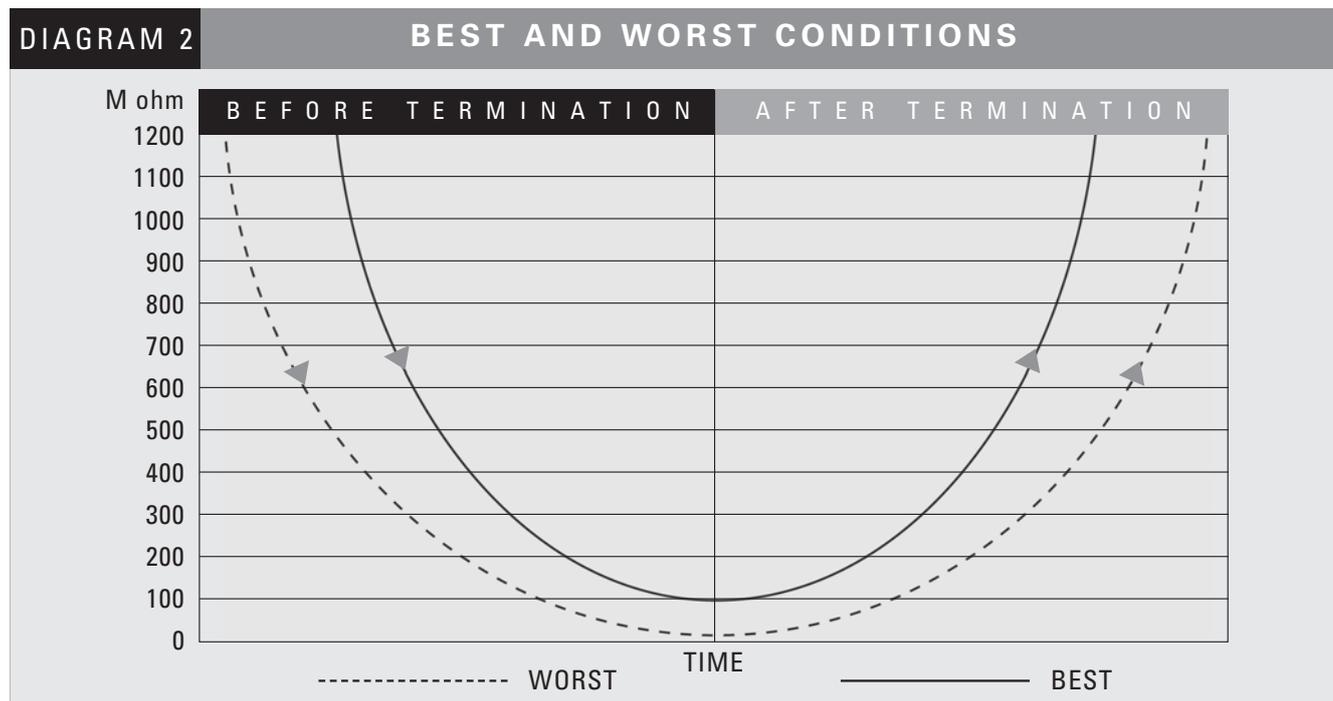

It is therefore a property of the cable, that when open to the atmosphere, the insulation resistance will begin to drop, and in the case of the smaller sizes of cable, this fall may be quite rapid. Whilst this may seem disconcerting, in practice it does not pose a problem. This is because, after the cable has been effectively sealed, the minute quantity of trapped moisture causing the low insulation resistance will disperse throughout the insulant at the cable end, therefore the reading will quickly rise as shown in diagram 2.

SYSTEM INTEGRITY

Moisture ingress at a position of sheath damage would extend in both directions from the point of entry. The depth of penetration will be in accordance with Diagram 1 and when the cable is cut and repaired by jointing, the moisture affected insulant will again be removed when stripping back the sheath to terminate the two cable ends.

SHEATH DAMAGE

We would finally stress that the effect of moisture on any Pyro Mi Cable is not a problem. Providing the cable has been sealed correctly at both ends, then the insulation resistance will rise to a satisfactory level and will be maintained. Indeed, the effect of moisture can be considered to be an advantage, since it will monitor the integrity of the cable. Thus if the cable was damaged during installation or was ineffectively sealed, this would be indicated as a fault which could be rectified prior to commissioning. Reference should be made to our Installation Recommendation No. IR200 for recommended installation and testing procedures.



Pyrotenax is a trademark of Tyco Thermal Controls LLC and its affiliates in designated countries

All of the information contained in this publication, including illustrations, is believed to be reliable. Users however, should independently evaluate the suitability of each product for their particular application. Tyco Thermal Controls makes no warranties as to the accuracy or completeness of the information, and disclaims any liability regarding its use. Tyco Thermal Control's only obligations are those in the Tyco Thermal Controls Standard Terms and Conditions of Sale for this product, and in no case will Tyco Thermal Controls or its distributors be liable for any incidental, indirect or consequential damages arising from the sale, resale, use or misuse of the product. Specifications are subject to change without notice. In addition Tyco Thermal Controls reserves the right to make changes - without notice to Buyer - to processing or materials that do not affect compliance with any applicable specification.

This document was supplied to you by:



Tyco Thermal Controls UK Limited
 3 Rutherford Road, Stephenson Industrial Estate,
 Washington, Tyne & Wear NE37 3HX, United Kingdom.
 Tel: +44 (0) 191 419 8200 Fax: +44 (0) 191 419 8201
www.tycothermal.com

Publication Number IS 470 Reprinted March 2005